

Aftermarket News (Oct'21)

1. New Vehicle Applications

a. COOL GEAR Condenser

Car Maker	Model	Year	Carmaker PN	DENSO PN	CG PN
TOYOTA	CAMRY	2012-2017	88460-06270	TG447760-6111	DI447780-3560

#New Part No

b. COOL GEAR Radiator

Car Maker	Model	Year	Carmaker PN	DENSO PN	Oil Cooler	CG PN
PERODUA	AXIA	2014	16400-BZ480		Without	DI261470-3990#
TOYOTA	YARIS	2014	16400-0Y100	422135-1480	Without	DI261470-3960#
TOYOTA	YARIS	2016	16400-0Y100	TG422135-1481	Without	DI261470-3960#

#New Part No

2. Phased Out Applications

CG Evaporator

<Background>

Due to no demand for many years, CG Evaporator PN 446600-5090 had been phased out.

<Next Action>

Please stop ordering this Part No.

DDS Wiper Blade

<Background>

Reminder: The following DDS Wiper Blade Part Nos have been phased out.
 Some has replacement Part Nos that will be split into RHD and LHD PNs.

Phased Out Part No		Replacement Part No (if any)			
		RHD Part No		LHD Part No	
DDS-013	DI261622-0020	-			
DDS-014	DI261622-0030	DDS-014R	DI261622-0740	DDS-014L	DI261622-0840
DDS-015	DI261622-0040	-			
DDS-016	DI261622-0050	DDS-016R	DI261622-0750	DDS-016L	DI261622-0850
DDS-018	DI261622-0070	DDS-018R	DI261622-0770	DDS-018L	DI261622-0870
DDS-019	DI261622-0080	DDS-019R	DI261622-0780	DDS-019L	DI261622-0880
DDS-020	DI261622-0090	DDS-020R	DI261622-0790	DDS-020L	DI261622-0890
DDS-022	DI261622-0110	DDS-022R	DI261622-0810	DDS-022L	DI261622-0910
DDS-024	DI261622-0120	DDS-024R	DI261622-0820	DDS-024L	DI261622-0920
DDS-026	DI261622-0130	DDS-026R	DI261622-0830	DDS-026L	DI261622-0930

<Next Action>

Please stop ordering the phased out Part Nos, and order the replacement Part Nos if available.

3. Packaging Change – CG Condenser Fan Motor

CG Condenser Fan Motor

<Background>

To enhance the image of packaging box design, CG Motor Box design will be renewed.

<Results>

Packaging box will be revised after September 2021 production, running change.

Below table shows the details of revised packaging box:

Current Packaging	New Packaging
	<p>Actual image not available at the moment:</p> 

4. Error in dimension in Catalogue - DENSO Ignition Coil

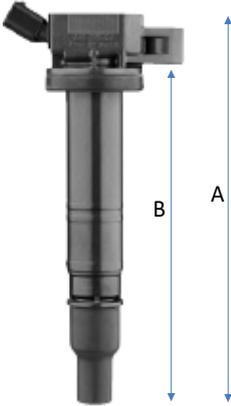
DENSO Ignition Coil

<Background>

There was incorrect indication of dimension of DENSO Ignition Coil in Part No. Catalogue.

<Results>

Please refer to below revised information, noting dimensions of A and B.

	DENSO Part No.	Dimension A (Unit: mm)	Dimension B (Unit: mm)
	099700-1010	136	112
	099700-1150	169	148
	099700-1470	169	148
	099700-1810	127	91
	099700-2120	169	148
	099700-2130	144	123
	099700-2430	150	135
	099700-2440	169	153
	099700-2500	168	153
	099700-2510	166	150
	099700-2520	150	130
	099700-2530	157	137
	099700-2540	147	120
	099700-2550	147	121
	099700-2560	147	128
	DI260210-0170	148	131.5

5. DENSO Horn – Changes in (a) Product Design and (b) Packaging Label

DENSO Horn – (a) Changes in Product Design

<Background>

New changes will be applied for Horn double terminal to the stratification parts (Part Stay – the metal plate holder to install the horn).

This is to protect mix parts in process manufacturing.

Materials and performance are not changed.

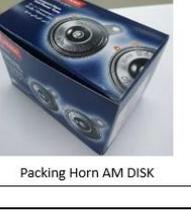
<Results>

The affected Part No. would be only for 8 Part No. of Double Terminal Horn as below:

No.	Part No.	Part name	Descriptions
1	JK272000-3380	Horn Assy. AM Set. High/Lo	Trumpet Waterproof 12V Double Terminal with accessories
2	JK272000-3390	Horn Assy. AM Set. High/Lo	Trumpet Waterproof 12V Double Terminal without accessories
3	JK272000-3400	Horn Assy. AM Set. High/Lo	DISK AM 24V with accessories
4	JK272000-3410	Horn Assy. AM Set. High/Lo	DISK AM 24V without accessories
5	JK272000-6900	Horn Assy. AM Set. High/Lo	Trumpet 12V Double Terminal with accessories
6	JK272000-6910	Horn Assy. AM Set. High/Lo	DISK AM double terminal 12V with accessories
7	JK272000-6920	Horn Assy. AM Set. High/Lo	DISK AM double terminal 12V without accessories
8	JK272000-6930	Horn Assy. AM Set. High/Lo	Trumpet 12V Double Terminal without accessories

Timing of change is running change from November 2021 delivery onwards.

Please refer to below for changing points.

Type	Current	New
Product Design	 <p>Packing Horn AM Trumpet</p>  <p>Horn Assy. H/P Trumpet waterproof</p>  <p>Horn Assy. L/P Trumpet waterproof</p>	 <p>Packing Horn AM Trumpet</p>  <p>Horn Assy. H/P Trumpet waterproof</p>  <p>Horn Assy. L/P Trumpet waterproof</p>
	 <p>Packing Horn AM DISK</p>  <p>Horn Assy. H/P DISK TYPE</p>  <p>Horn Assy. L/P DISK TYPE</p>	 <p>Packing Horn AM DISK</p>  <p>Horn Assy. H/P DISK TYPE</p>  <p>Horn Assy. L/P DISK TYPE</p>

DENSO Horn – (b) Changes in Packaging Label

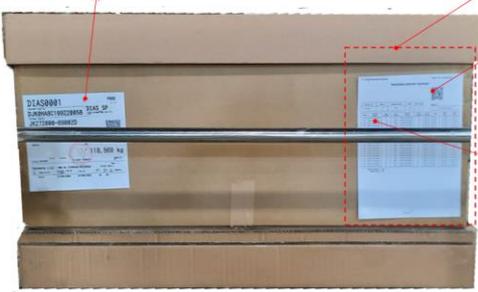
<Background>

To avoid delivery related issues due to human errors, QR Code Label will be used for 10pc box and outer box.

<Results>

Timing of change is from next firm order.

Please refer to below for changing points.

Type	Current	New
10 pc Box	 <p>Printed all part no.</p> <p>Part No. by put ✓ Mark</p>	 <p>QR Label</p> <p>Part No. is changed with auto printed (Inner Tag with QR)</p>
Outer Packaging		 <p>Case Mark Label</p> <p>Add QR label</p> <p>QR Code that mentions: DNIA Part No. and Quantity</p> <p>Box Contents that mention inside box (Part No., Qty, date & time of scan)</p>

For more information, please contact your DENSO Sales Company.